

Tel-Aviv. September 08, 2009

Piezo DC sirens problems for June until August 2009 shipments

Please notice few customers complain during Av-Gad panel's installation.


- When powering up the dial LED is off, or keypad is off
- Few or most panel zones are not functioning
- Dialing to accounts, but the siren sound not generated

Such problems caused only when using DC Piezo sirens, by now this issue solved in our production line. If you face any strange trouble try to disconnect the siren/s first.

To bypass the problem: Power off the panel, remove the +SIR wire terminal in the panel, wire the positive siren/s lead/s directly to the battery positive terminal.

Keep the negative siren lead wired to -SIR at panel. Please do so for both internal and external sirens.

How to power sirens from battery

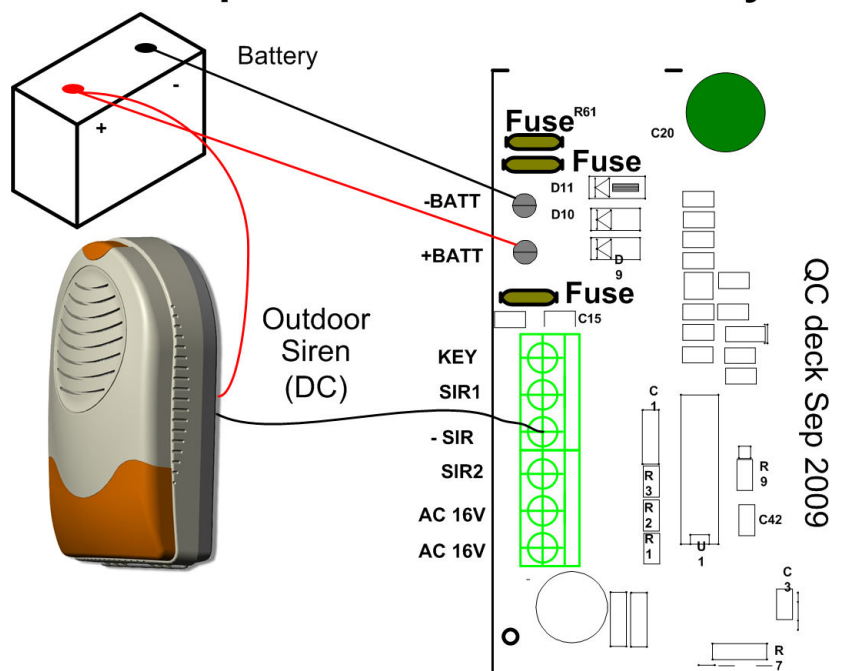

To prevent problem caused by DC sirens ,connect the Positive Siren/s lead/s directly to + battery

Av-Gad Systems Ltd.
 QC Manager – Eldad Yekutiely
 Tel: +972-3-681 6767, ext 219